



Photo 16: View of right engine as received at engine inspection facility.